
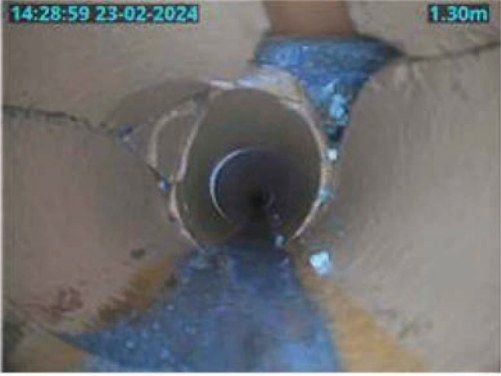



Descriptive Report with Remarks and Observation Images

Section 14

| Pos | Video Ref | Code | Description | Image |
|--------|-----------|------|--|--|
| 00.00m | | MH | Start node type, manhole FWMH1 | |
| 00.00m | 0:00:00 | WL | Water level: 0% Height/Diameter | Image Provided - Ref: 13_1  |
| 00.80m | 0:00:09 | B | Broken pipe from 12 o'clock to 12 o'clock - Severity 4 | |
| 01.30m | 0:00:20 | H | Hole in drain/sewer from 12 o'clock to 03 o'clock - Severity 4 | Image Provided - Ref: 13_4  |
| 12.90m | 0:01:08 | H | Hole in drain/sewer from 10 o'clock to 12 o'clock - Severity 4 | Image Provided - Ref: 13_5  |
| 14.20m | 0:01:21 | CM | Cracks, multiple from 06 o'clock to 12 o'clock - Severity 2 | |

Total Defects for section

DRB Grade for Section

